


NOTE: View from back of connector.

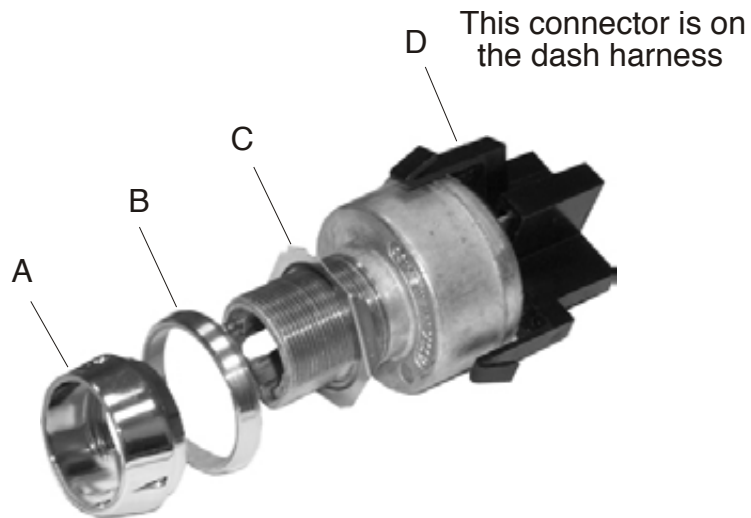

NOTE: Please keep in mind that this is an upgraded switch, not an original replacement, and as such, the flat side on this switch may be in a different location than was your original. If you mount this new AAW switch in your dash and the flat side is in fact in a different location, the key may not line up as the original did. This will not alter the performance of the switch in any way. If you wish for your key to line up as it did in the OEM application, you will need to file out the flat spot in your original dash opening so that the switch can be rotated to the correct position. Once the backing nut C is set so that the depth of the switch is correct for your application, and bezel nut A is firmly tightened, the switch will be secure and will not rotate.

INSTALLATION

NOTE: Some ignition switches came packaged with a copper lamp holder bracket. This bracket was removed before packaging. However, the instruction sheet related to the switch shows this bracket. This bracket is not used in this application and it's installation can be ignored.

1. Plug in connector D from the dash wiring harness (bag G).
2. Install the back-up nut C onto the switch. The depth of this nut will have to be determined when mounting the switch.
3. Insert the switch into the hole in the dash panel.
4. Install your original dash bezel plate.
5. Slide on collar B.
6. Screw on threaded collar A
7. Insert your existing lock cylinder into the new switch. This allows you to utilize your original keys

NOTE: AAW has new lock cylinders with the correct GM style keys for your new 500684 ignition switch. Check below for your vehicle's correct application.



AAW P/N 500674 (smooth face):

500560 - 1960-66 Chevy truck
 510360 - 1965 Chevy Impala
 510372 - 1966-68 Chevy Impala



AAW P/N 500672 (with finger guard):

500423 - 1955-56 Chevy car
 500434 - 1957 Chevy car
 510217 - 1959-60 Chevy Impala
 510063 - 1961-64 Chevy Impala
 510267 - 1961-64 Chevy Corvette



**American
 Autowire**

www.americanautowire.com 856-933-0801

IGNITION SWITCH
 Classic Update Series
 VARIOUS APPLICATIONS

500684

92965941 instruction rev 3.0 3//28/2013